

MARION COUNTY SURVEYOR'S OFFICE


SECTION CORNER RECORD

DEBRA S. JENKINS
MARION COUNTY SURVEYOR

SEC. 16 TWN. 14_N RNG. 2_E

BRYAN F. CATLIN, PLS
TECHNICAL SUPERVISOR

Date: 1-22-10
Party Chief: Wilcoxen
Crew: Finney
Type of Marker: Survey Marker nail set
Method of Establishment: County: 2-3-1992
IN S.P.C. E Zone, NAD 83 (1986)
Name: 14021611
N: 490 156.746 0(m)
E: 44 598.818 0(m)

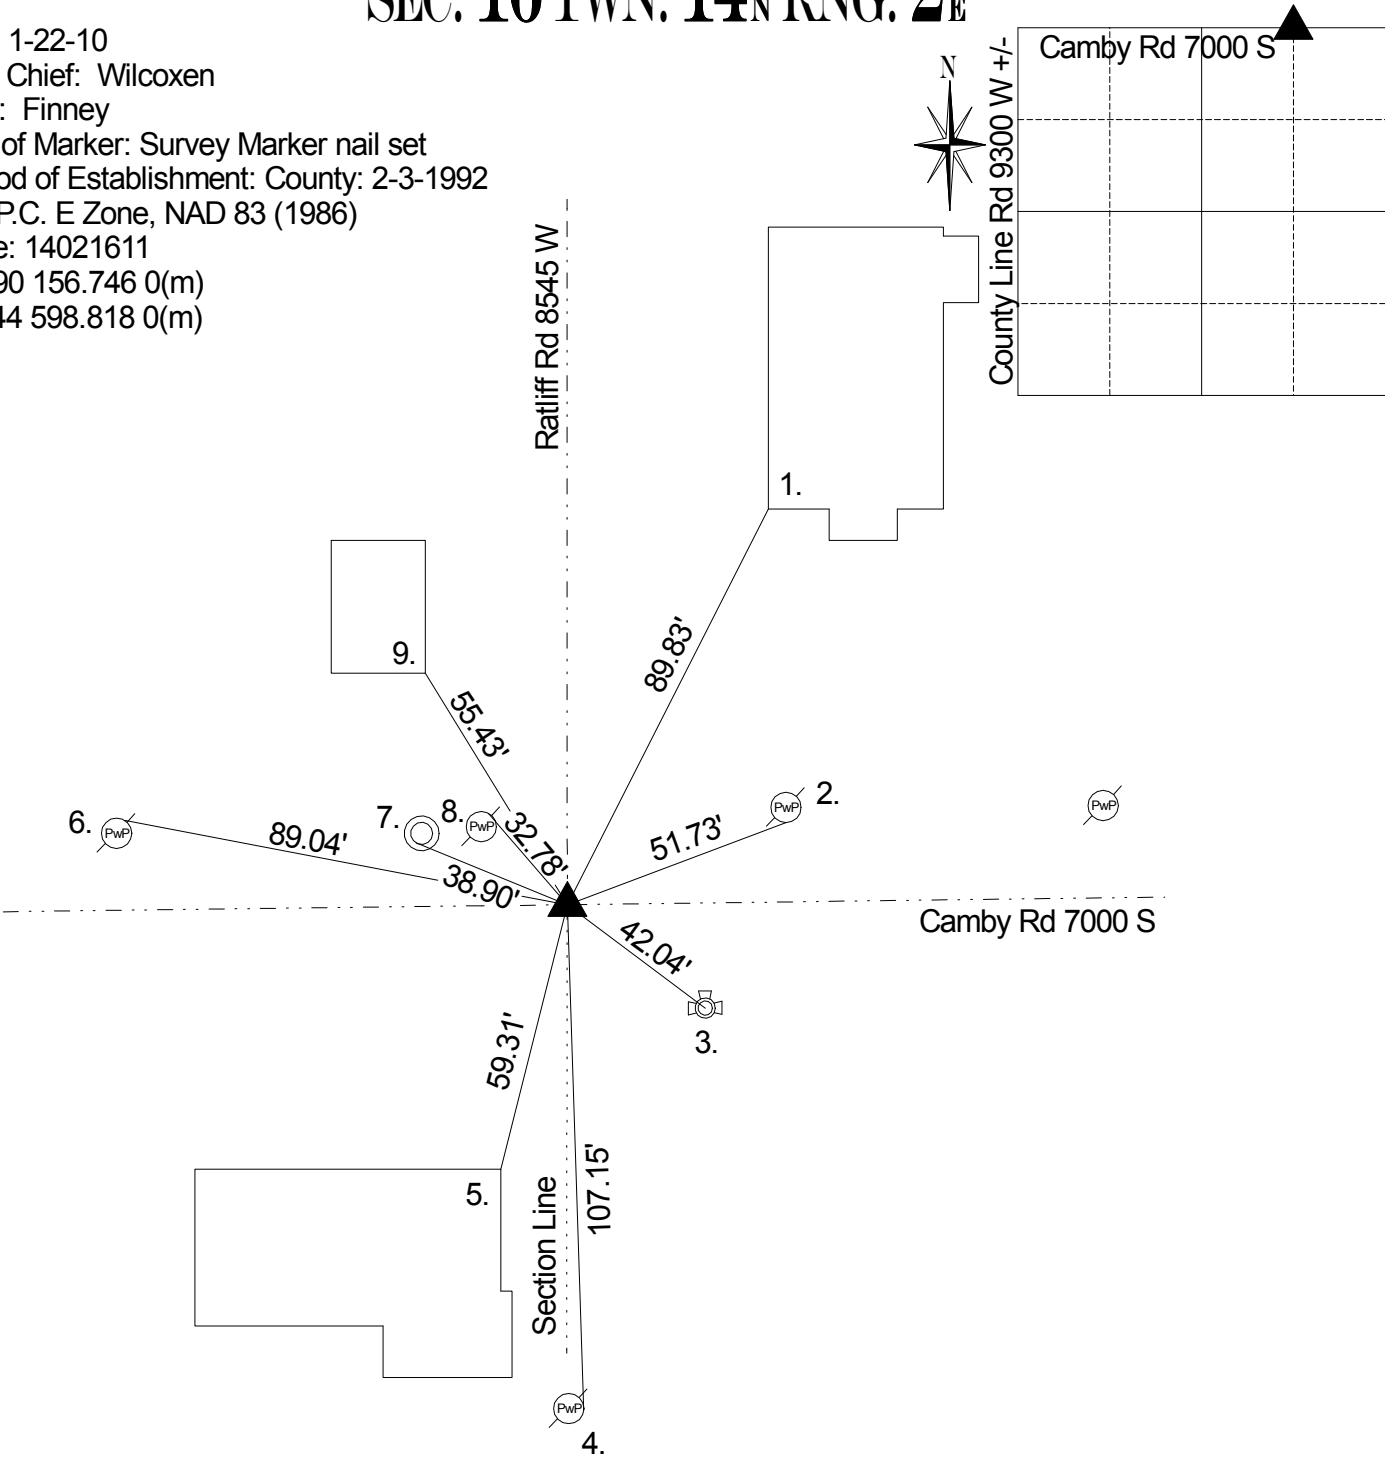

2-23-1857 Wm. P. Case found witnesses: 18" oak N 75 E 71 links, 10" ash N 47 W 43 links, as per pg 13 of the Decatur twp legal book. 10-28-1959 Monroe called a RR spike. 11-16-59 Monroe added corner ties. 3-15-76 R. Miller called a PK nail. 7-8-85 Green called a PK nail. 10-1-85 Wilcoxen excavated corner and found a nail at surface, 3" down a RR spike, down 4" a boat spike, then a stone 11 1/2" down. 2-3-92 Whiteside called a RR spike at surface. 10-1-98 Kiste called same. 6-19-1999 Wilcoxen called same. 8-28-2004 Wilcoxen called same. 1-22-10 Wilcoxen set a survey mark nail.

REF.	DISTANCE	DESCRIPTION
1.	89.83'	SW corner of stone 8510 Camby Rd
2.	51.73'	Mag nail w/bw SE PwP #426-741x 3" up
3.	42.04'	Top nut of fire hydrant
4.	107.15'	Mag nail w/bw E PwP #56-741x
5.	59.31'	Corner of brick 8515 Camby Rd
6.	89.04'	Mag nail w/bw NE PwP #241-741x 3" up
7.	38.90'	Cut 'x' SW rim storm sewer manhole
8.	32.78'	Mag nail w/bw NE PwP #55-741x 3" up
9.	55.43'	Corner of brick shed

THIS CORNER POSITION
REPRESENTS A "TITLE" CORNER
AND MAY NOT NECESSARILY
REPRESENT THE POSITION BASED
ON RECORD CORNERS.